




Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 1 of 23
06/10/2024 1:39 PM

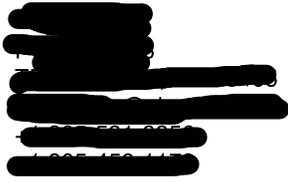

1969 Jeep 4WD
Engine:
Plate:
Odometer In: 61637
Odometer Out: 61659

Advisor: Kevin Larson
Technician: Rob Krohn

GRAND TOTAL: \$15,804.57

✓ PAID

Reason for Customer's Visit

Just bought vehicle - at LVS Motors and needs inspection - main concern no braking power

Primary use of vehicle

one of many

SERVICES

1 Top Gear inspection - 3 areas of Priority Concern - BRAKES, CLUTCH AND STEERING

SUBTOTAL: \$122.40

LABOR

Inspection determines work needed and priority level. Inspection includes attempting to recreate customer concern(s) and correlate work needed to customer concern(s). Includes physical non-tear down on the rack inspection with test drive and code scan.

Labor: \$99.00
Parts: \$23.40
Fees: \$0.00
Sublet: \$0.00

Green = No Issues / Yellow = Not Applicable / Red = Needs Attention - Anything marked "Red" will have additional notes to relay why it needs attention, either a preventative maintenance item that is due or a priority remedy is needed.

PARTS	QTY	EACH	TOTAL
Wheel Lug Nut	3.0	\$7.80	\$23.40

2 Advanced Assessment - Priority Concern- Electrical- turn signals, reverse lights, and license plate lights inop-

SUBTOTAL: \$339.26

LABOR

Advanced Assessment - Priority Concern- Electrical- turn signals, reverse lights, and license plate lights inop-

Labor: \$300.00
Parts: \$39.26
Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
Hazard Warning Flasher	2.0	\$19.63	\$39.26

3 Advanced Assessment - Priority Concern- Complete Under Carriage Cleaning and Inspection- Leaks, Multiple-

SUBTOTAL: \$150.00

LABOR

Advanced Assessment - Priority Concern- Complete Under Carriage Cleaning and Inspection- Leaks, Multiple-

Labor: \$150.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 2 of 23
06/10/2024 1:39 PM

4 Advanced Assessment - Priority Concern- Brake inspection / Parking brake inspection

SUBTOTAL: \$150.00

LABOR

Advanced Assessment - Priority Concern- Brake inspection / Parking brake inspection

Labor: \$150.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

5 Remove, Inspect and Repair Multi-Function Switch

SUBTOTAL: \$281.25

LABOR

Remove, Inspect and Repair Multi-Function Switch- Removed steering wheel, repaired wiring and now working correctly.

Labor: \$281.25
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

6 Teardown and Inspect Transfer Case-

SUBTOTAL: \$579.92

LABOR

Teardown and Inspect Transfer Case- While clutch replacement is being done would be the time to teardown and inspect- unknow final cost if needing to be fully rebuild but need to know what is going on first- Transfer case- found linkage pin had falling out of bottom of shifter arm mechanism. disassembled shifter mechanism and pressed pin back into bottom of shifter. verified 2wd- 4hi and 4lo

Labor: \$337.50
Parts: \$242.42
Fees: \$0.00
Sublet: \$0.00

PARTS

	QTY	EACH	TOTAL
TRANSFER CASE OUTPUT SEAL	1.0	\$14.78	\$14.78
Transfer Case Input Shaft Seal	2.0	\$38.95	\$77.90
Gear Oil 75W-90 QUART(S)	2.0	\$25.92	\$51.84
Transfer Case Output Shaft Seal	2.0	\$48.95	\$97.90

7 Transmission Removal For Access To Clutch

SUBTOTAL: \$562.50

LABOR

Transmission Removal For Clutch & Rear Main Seal Replacement

Labor: \$562.50
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

8 Clutch Replacement-W/Rear Main Seal Replacement

SUBTOTAL: \$1,161.32

LABOR

Clutch Replacement- Remove and replace the clutch disc, pressure plate, pilot bearing, release bearing, and resurface flywheel + installed new clutch cable- Installed all parts, adjusted cable 2X times to get better feel. Now working well.

Got the transmission out and found the pressure plate is bent, half the springs were pushed in and one of pressure plate bolts was crossed thread and broke off, I got the broken bolt out of the flywheel and retapped the other bolts. I removed the main bears and cleaned everything up ready to install the new bearings and rear main seal

long test drive clutch works great shifts nice and smooth. The steering still has play at the wheel, - unable to adjust further.

Labor: \$618.75
Parts: \$426.75
Fees: \$15.82
Sublet: \$100.00



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 3 of 23
06/10/2024 1:39 PM

PARTS	QTY	EACH	TOTAL
CLUTCH KIT	1.0	\$375.73	\$375.73
REAR MAIN SEAL KIT	1.0	\$51.02	\$51.02
HAZMATS & FEES			
SHIPPING	1.0	\$15.82	\$15.82
SUBLETS			
flywheel resurface			\$100.00

9 Steering Gear Adjust + Fluid Fill (If Applicable) **SUBTOTAL: \$225.00**

adjust steering gear, feels good on rack, will need to road test to make sure tighter.

Labor: \$225.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

LABOR

Steering Gear Adjust + Fluid Fill (If Applicable)

Adjusted the drag link took it apart cleaned out the old grease put it back together was able to tighten up the adjustment a little bit more. Steering gear and joint should be replaced.

10 Replace Brake Master Cylinder + Bleed Brake System- **SUBTOTAL: \$833.55**

LABOR Labor: \$450.00

Replace Brake Master Cylinder + Bleed Brake System- Remove and replace the brake master cylinder, Created new fittings to work with new style brake master-Bled the brake system, brakes working correctly. Parts: \$383.55

Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
Brake Fluid	1.0	\$24.92	\$24.92
BRAKE MASTER CYLINDER-MANUAL BRAKE	1.0	\$346.45	\$346.45
Tube Fitting	1.0	\$12.18	\$12.18

11 Rear Differential Pinion Seal Replacement- **SUBTOTAL: \$238.18**

LABOR Labor: \$168.75

Rear Differential Pinion Seal Replacement- Parts: \$69.43

Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
Gear Oil 75W-90 QUART(S)	2.0	\$26.13	\$52.26
REAR DIFFERENTIAL PINION SEAL	1.0	\$17.17	\$17.17

12 Front Differential Pinion Seal Replacement- **SUBTOTAL: \$238.18**

Got the front drive line installed, serviced the front differential 2 pints

Labor: \$168.75
Parts: \$69.43
Fees: \$0.00

LABOR

Front Differential Pinion Seal Replacement-



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 4 of 23
06/10/2024 1:39 PM

Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
Gear Oil 75W-90 QUART(S)	2.0	\$26.13	\$52.26
REAR DIFFERENTIAL PINION SEAL	1.0	\$17.17	\$17.17

13 Oil Pan Gasket Replacement- Engine-

SUBTOTAL: \$665.60

LABOR
Oil Pan Gasket Replacement- Engine-

Labor: \$562.50
Parts: \$103.10
Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
ENGINE OIL PAN GASKET	1.0	\$26.51	\$26.51
Motor Oil 15W-40 QUART(S)	4.0	\$7.00	\$28.00
Radiator Cap	1.0	\$23.25	\$23.25
Brake Clean	2.0	\$12.67	\$25.34

14 Front Crank Shaft Seal- Remove and Replace -

SUBTOTAL: \$469.77

Timing cover installed, water pump resealed also installed, replaced bypass hose from water pump to intake manifold

Labor: \$225.00
Parts: \$244.77
Fees: \$0.00
Sublet: \$0.00

LABOR
Front Crank Shaft Seal- Remove and Replace -

PARTS	QTY	EACH	TOTAL
FRONT CRANK SEAL	1.0	\$25.54	\$25.54
Engine Timing Cover Gasket Set	1.0	\$49.08	\$49.08
Accessory Drive Belt	1.0	\$48.03	\$48.03
Engine Oil Filter	1.0	\$33.38	\$33.38
Convention Green	1.0	\$32.13	\$32.13
Brake Clean	2.0	\$8.38	\$16.76
Engine Timing Cover Gasket Set	1.0	\$39.85	\$39.85

15 Parking Brake Cable Replacement- Remove and replace + Adjustment

SUBTOTAL: \$440.75

LABOR
Parking Brake Cable Replacement- Remove and Replace + Adjustment -Removed brake cable, performed the adjustment and now parking brake is working and holding as it should.

Labor: \$337.50
Parts: \$103.25
Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
PARKING BRAKE CABLE- FRONT	1.0	\$103.25	\$103.25

16 Reverse Light + Wiper Motor Switch Repair-

SUBTOTAL: \$225.00

LABOR
Labor: \$225.00



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 5 of 23
06/10/2024 1:39 PM

Reverse Light + Wiper Motor Switch Repair- Wire in, inline fuses to get systems to work correctly- Found reverse lights not plugged in, windshield wipers are functional, make a loud noise while operating and are binding, will require time to dig in further to find source of bind/noise, Able to get the wipers working correctly, found parts loose under dash. Post repair wipers are working smooth. Wiper switch is a bit worn out and hard to turn off. Possible removal and cleaning will make action smoother. Also have the reverse lights functional.

Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

17 Oil Filter Housing Adapter Gasket- Remove and Replace -

SUBTOTAL: \$256.13

LABOR

Oil Filter Housing Adapter Gasket- Remove and Replace -

Labor: \$225.00
Parts: \$31.13
Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
(the right stuff gasket maker)	1.0	\$31.13	\$31.13

18 Remove and Install New OE Style License Plate Light Fixture -

SUBTOTAL: \$188.98

LABOR

Remove and Install New OE Style License Plate Light Fixture - installed new license plate light fixture and is working

Labor: \$112.50
Parts: \$76.48
Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
LINCENSE PLATE LIGHT ASSEMBLY	1.0	\$76.48	\$76.48

19 Track Bar Bushing Replacement

SUBTOTAL: \$168.75

LABOR

Track Bar Bushing Replacement

Labor: \$168.75
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

20 Upgrade front and rear suspension with 2 inch lift-

SUBTOTAL: \$4,359.25

Installed new front and rear leaf springs, replaced rear shackles, rebuild the front shackles while we wait for the new front shackles to arrive, installed new front and rear shocks.

Labor: \$1,485.00
Parts: \$2,874.25
Fees: \$0.00
Sublet: \$0.00

LABOR

Upgrade rear suspension with 2 inch lift- Installed new front and rear leaf springs, replaced rear shackles, rebuild the front shackles while we wait for the new front shackles to arrive, installed new front and rear shocks. Adjusted track bar to help get vehicle level. swapped rear leaf springs and it sits level. added longer shackles to front to add another inch to the height to level out the front to back.

Front

PARTS	QTY	EACH	TOTAL
2 Inch Suspension Lift- New front and rear leaf springs, shackles, bushings, hardware + shocks	1.0	\$2,824.95	\$2,824.95



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 6 of 23
06/10/2024 1:39 PM

Spray Paint 2.0 \$24.65 \$49.30

21 Remove & Re-Install Rear Brake Shoes-

fixed the left rear brake shoes as they were installed backwards, now have them properly installed and lubricated

SUBTOTAL: \$168.75

LABOR

Remove & Re-Install Rear Brake Shoes- Installed backwards

Labor: \$168.75
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

22 Clutch Cable Replacement-

LABOR

Clutch Cable Replacement-Adjusted cable on clutch and is working as it should. clutch is bit stiff but it will seat in.

SUBTOTAL: \$426.52

PARTS

CLUTCH CABLE

QTY	EACH	TOTAL
1.0	\$66.52	\$66.52

Labor: \$360.00
Parts: \$66.52
Fees: \$0.00
Sublet: \$0.00

23 Replace Dash Light Bulbs + Holders & Replace Flasher Relay

LABOR

Replace Dash Light Bulbs + Holders & Replace Flasher Relay. Also found lose wire for turn signals. Now turn signals are working correctly.

SUBTOTAL: \$148.74

PARTS

Hazard Warning Flasher

Instrument Panel Light Bulb

QTY	EACH	TOTAL
2.0	\$8.60	\$17.20
2.0	\$9.52	\$19.04

Labor: \$112.50
Parts: \$36.24
Fees: \$0.00
Sublet: \$0.00

24 Suspension adjustment

LABOR

Check suspension, get vehicle to sit level- Ok adjusted the track arm the front end is centered it drives better, it still sits lower on the driver's side, what needs to happen is to swap the rear springs from side to side. Adjusted the steering draglink from the steering box. Also tightened up the U bolts on the Axel's after they settled

SUBTOTAL: \$0.00

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

25 Alignment Pre 1980's

LABOR

Alignment Check - Check Includes: Test Drive + Mechanical Inspection Pertaining To Steering/Suspension Parts- center link for tie rods is bent and I'm unable to set the toe. will also need angled leaf spring shims to set the caster.

SUBTOTAL: \$443.98

Alignment

Additional Time Needed To Free-Up Steering Parts + Install Shims

Labor: \$431.99
Parts: \$0.00
Fees: \$11.99
Sublet: \$0.00



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 7 of 23
06/10/2024 1:39 PM

PARTS	QTY	EACH	TOTAL
2 DEGREE WEDGE PLATE	1.0	\$0.00	\$0.00

HAZMATS & FEES	QTY	FEE	TOTAL
SHIPPING	1.0	\$11.99	\$11.99

26 TIRE REPLACEMENT -

SUBTOTAL: \$1,200.00

LABOR

TIRE REPLACEMENT - While removing and installing the wheels post tire replacement one of the studs on the driver side rear was damaged, we were able to chase the threads and install the wheel with all the lug nuts. Due to oversized tires, when you get to full lock we have slight interference, will need adjust steering stops to ensure proper steering without interference. Also have ordered wheel spacers as well to ensure proper fit and esthetics.

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$1,200.00

SUBLETS	TOTAL
OPEN COUNTRY III 265-75R15	\$1,200.00

27 Paint Match Wheels-

SUBTOTAL: \$0.00

LABOR

Remove Wheels. Vehicle will sit for a day.
Take wheels to americas tire to have tires dismounted
Paint at calderons, and take bake to americas tire

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

28 Install wheels and tires

SUBTOTAL: \$477.44

LABOR

Install wheels and tires
Remove Wheels- Front, Install wheel spacers for clearance issues.

Labor: \$180.00
Parts: \$297.44
Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
WHEEL SPACERS	2.0	\$148.72	\$297.44

29 Stud Repair- Driver Side Rear Wheel-

SUBTOTAL: \$75.00

LABOR

Stud Repair- Driver Side Rear Wheel-
Removed rear Wheels had to open up the stud holes in the drum on the right rear, the studs were preventing the drum to sit flush on the axle. Someone at one time replaced the studs and didn't realize that they were a little different.

Labor: \$75.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

30 Thrust bearing replacement

SUBTOTAL: \$857.05

LABOR



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 8 of 23
06/10/2024 1:39 PM

remove and replace main bearings- found the crank shaft is moving back and forth about 30tho. The thrust bearing is worn out. Replaced the main crank shaft bearings with new rear main seal. Cleaned the oil pump pick installed with new gasket. Installed the oil pan, R&R transmission

Labor: \$650.00
Parts: \$207.05
Fees: \$0.00
Sublet: \$0.00

PARTS	QTY	EACH	TOTAL
Engine Crankshaft Main Bearing Set	1.0	\$138.37	\$138.37
Engine Oil Pan Gasket Set	1.0	\$49.13	\$49.13
REAR MAIN SEAL KIT	1.0	\$0.00	\$0.00
Engine Oil Filter	1.0	\$19.55	\$19.55

31 Loose steering

SUBTOTAL: \$0.00

LABOR

estimate what we need to replace- Adjusted the drag link took it apart cleaned out the old grease put it back together was able to tighten up the adjustment a little bit more

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

32 Fuel sender

SUBTOTAL: \$128.25

LABOR

run a wire from the tank to the gauge: found the reason for Gas gauge not working there's no wire for it to plug in . Just have to chase the wiring harness back until I find the wiring Found the wire that goes to the sending unit for the gas gauge, made a new plug for it and it's good

Labor: \$128.25
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

33 Heater Core - Bypass- Fee Waved -

SUBTOTAL: \$112.50

LABOR

Heater Core - Bypass- Buy passed heater core- Checked system, no leaks.

Labor: \$112.50
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

34 Sold Customers Old Tires

SUBTOTAL: \$0.00

LABOR

Sold Customers Take Off Tres Post New Tire Purchase- sold customers pre-owned tires for \$250.00 per the customer request. Added the \$250 as a labor discount to the invoice.

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 9 of 23
06/10/2024 1:39 PM

Terms of Service:

1. "YES, COMPLETE WORK"

I hereby authorize the corresponding service to be done along with the necessary materials. I acknowledge that when an estimate is sent the purpose of the document is to provide an estimate on potential expenses, based upon the information available at this time. Costs are flexible and work needed is liable to change. Repair orders and updates are based upon the information available at a specific time. Costs are flexible and work needed is liable to change as this is "in progress" and issues or obstacles may arise during the replacement or tear down process. The full amount/remaining balance is due at time of vehicle pick up and work completion. All Parts removed will be discarded unless instructed otherwise before work is approved.

2. "YOU MAY DRIVE MY CAR ON PUBLIC & PRIVATE ROADS"

Shift N Gears staff may operate my vehicle for the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto. Storage fees can be applied if the vehicle has not been paid and picked up on the third business day post notice this it is completed and ready. Once storage fees are applied, the totality of that invoice must be paid before pick up can occur. Implementation of storage fees and fee amount can vary depending on situation.

4. "ONLINE COMMUNICATION OK"

I welcome email and text from SHIFT'N GEARS as a means of receiving copies of my estimate, work order, and invoice.

5. "THEFT & LOSS"

I understand and accept that my vehicle will be on public and private property: I accept that Shift' N Gears is not responsible for any type of loss or damage in case of fire, theft, flood or any other cause to my vehicle or personal items.

6. "WARRANTY"

Parts Warranties is dedicated by the manufacturer's offered warranty, terms and lengths may vary. Any and all after market parts or customer bought parts are not covered under warranty. If a part is determined to have been defective for any reason - then the customer can be responsible for the difference in labor incurred to have replaced. Shift'N Gears is not responsible for defective parts, but will however; work w/ the customer to obtain rights & remedies available according to the original equipment manufacture's current warranty for such part / accessory. Warranty may be voided if there is, but not limited to : misuse /abnormal operation;; neglect; in case of an accident or repairs are committed by another auto shop.

7. "HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these terms.

GRAND TOTAL: \$15,804.57

Total Labor: \$9,071.74
Labor Discount: (\$362.50)
Total Parts: \$5,294.47
Total Fees: \$27.81
Total Sublets: \$1,300.00
County Environmental - EPA Waste & Disposal Fee /
HAZMAT: \$9.00
Sales Tax: \$464.05

✓ PAID

06/17/2024 01:17 PM

Paid by Credit Card via Terminal: **\$676.89**

Transaction ID: "eywWC1bY6q7gM3rW5dE"

Signed:

06/10/2024 01:43 PM

Paid by Check: **\$5,000.00**

Notes: "check # 6193"

04/19/2024 11:48 AM

Paid by Check: **\$8,000.00**

Notes: "4975"

02/29/2024 12:40 PM

Paid by Credit Card via Terminal: **\$2,127.68**

Transaction ID: "gKZ1oILL1X0iHoHMEsv"

Signed:

Authorization:



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 10 of 23
06/10/2024 1:39 PM

INSPECTION REPORT

Top Gear inspection - 3 areas of Priority Concern - BRAKES, CLUTCH AND STEERING

Tires- Pressure/Condition- With PSI

All at 25 psi

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Tire-Spare- Pressure/Condition - With PSI

At 22psi

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Exterior- 4 Corners Of Vehicle Pictured With Defects Noted If Any



Written by Jimmy Purdy at 02/21/2024 07:32 PM

Exterior- Lighting

No turn signals, no reverse lights no license plate lights

**Advanced Assessment - Priority Concern- Electrical-
turn signals, reverse lights, and license plate lights inop-
\$300.00 +tax**

Approved in person, 12:01pm 2/26/24

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Exterior- Wipers

Wipers moved about half way and stopped

Written by Jimmy Purdy at 02/21/2024 07:32 PM



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 11 of 23
06/10/2024 1:39 PM

Interior- Oil Sticker Present

10/7/23 sticker due based on time

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Interior- Instrument Cluster- Picture With Vehicle Running

Speedometer works, no

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Interior- Code Scan- Picture Of Results

HVAC-Cabin Air Filter

HVAC- AC/Heat Includes Blower Motor Speeds

No operation

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Underhood- Battery Test/Condition

Underhood- Engine Oil/Condition

Underhood- Transmission Fluid Level/Condition

Manual transmission fluid is dirty

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Underhood- Coolant Level/Condition In Res.

Resivour empty



Written by Jimmy Purdy at 02/21/2024 07:32 PM

Underhood- Brake Fluid Level/Condition

Empty on rear side



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 12 of 23
06/10/2024 1:39 PM

Written by Jimmy Purdy at 02/21/2024 07:32 PM

- Underhood- Clutch Fluid Level/Condition
- Underhood- Power Steering Fluid Level/Condition
- Underhood- Washer Fluid Reservoir
- Underhood- Engine Air Filter

Oil bath housing

Written by Jimmy Purdy at 02/21/2024 07:32 PM

- Underhood- Spark Plugs
- Cooling System- Radiator/Heater Hoses
- Cooling System- Misc Coolant Hoses

Brakes- Front With Pads Percentage

Drum rec inspection

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Brakes- Rear With Pads Percentage

Drum rec inspection

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Road Test 1 mile

No brakes, steering loose, clutch slips

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Road Test- Parking Brake Holds Vehicle

Cable is frozen, may have issue in brake assembly or cable



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 13 of 23
06/10/2024 1:39 PM

Advanced Assessment - Priority Concern- Brake inspection / Parking brake inspection \$300.00 +tax

Approved in person, 12:01pm 2/26/24

Written by Jimmy Purdy at 02/21/2024 08:58 PM

Road Test- Engine Start Up, Idle Quality

Hard start when cold

Written by Jimmy Purdy at 02/21/2024 07:31 PM

Road Test- Drive & Reverse Engagement

Road Test- Transmission Shifting Quality

Clutch slips when accelerating

Written by Jimmy Purdy at 02/21/2024 07:31 PM

Road Test- Braking

No fluid in rear brake reservoir no signs of leaks rear hard brake line to rear right wheel is not routed properly



Written by Jimmy Purdy at 02/21/2024 07:31 PM

Road Test- Vibrations/Noises/Clunks

No abnormalities

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Road Test- Alignment

Front end is very loose lots of play in steering gear

Written by Jimmy Purdy at 02/21/2024 07:31 PM

Under Car- Leaks/Seeps




Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 14 of 23
06/10/2024 1:39 PM

Front pinion seal leaking, transfer case front output seal leaking
Oil filter adapter housing gasket leaking, front main seal leaking, oil pan gasket leaking.
Rear pinion seal seeping.
Front left and right axle ball sockets seeping.

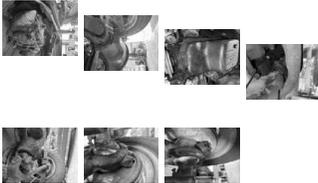

Advanced Assessment - Priority Concern- Complete Under Carriage Cleaning and Inspection- Leaks, Multiple- \$300.00 +tax

Approved in person, 12:01pm 2/26/24

Written by Jimmy Purdy at 02/21/2024 07:31 PM

✓ Under Car- Differential(s) Gear Oil Level/Condition

Rear fluid very dark, tcase low and dark. Front is good



Written by Jimmy Purdy at 02/21/2024 07:32 PM

✓ Under Car-Transfer Case Fluid Level/Condition

Fluid is low and dirty

Written by Jimmy Purdy at 02/21/2024 07:32 PM

✓ Under Car- Fuel Filter

✓ 4WD /AWD

Stuck in 4wd and shifter does not feel connected to tcase. No obvious issues seen



Written by Jimmy Purdy at 02/21/2024 07:31 PM

✓ Brakes- Brake Hoses



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 15 of 23
06/10/2024 1:39 PM

All brake hoses old and weathered



Written by Jimmy Purdy at 02/21/2024 07:31 PM

Suspension/Steering- CV Axles

Suspension/Steering- Wheel Bearings Front

Suspension/Steering- Wheel Bearings Rear

Suspension/Steering- Upper & Lower Control Arm & Ball Joints

Suspension/Steering- Front Shocks/Struts

Shocks are new,

Leaf spring bushings are worn left rear leaf spring bushing is completely gone and is wearing through eyelit bolt



Written by Jimmy Purdy at 02/21/2024 07:31 PM

Suspension/Steering- Rear Shocks

Old and bushing are worn

Leaf spring bushings are worn



Written by Jimmy Purdy at 02/21/2024 07:31 PM

Suspension/Steering- Sway Bar Bushings/End Links

Suspension/Steering- Steering Linkage/Rack & Pinion/ Tie Rods

Steering linkage is worn and boots are torn





Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 16 of 23
06/10/2024 1:39 PM

Written by Jimmy Purdy at 02/21/2024 07:31 PM

Stock Ride Height

Stock Lug Nuts

Additional Findings

Front axle hubs were set to lock
Rear hatch does not latch properly and could open while driving

Written by Jimmy Purdy at 02/21/2024 07:32 PM

Customer Concern

Verified no rear brake application

Written by Jimmy Purdy at 02/21/2024 07:32 PM



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 17 of 23
06/10/2024 1:39 PM

FINDINGS

Right side reverse light bulb socket not connected, soldered bulb to wire, fuse for circuit blown due to loose contact in bulb socket, need to rewire circuit to accept a blade fuse, (currently an odd sized glass fuse) brake switch not working as its a pressure switch and master cylinder needs to be replaced. Circuit to wiper motor switch needs to be rewired with a blade style fuse link.

**Reverse Light + Wiper Motor Switch Repair-
+tax** **\$225.00**

Approved in person, 12:39pm 2/29/24

Written by Jimmy Purdy at 02/29/2024 06:36 PM

Brake master cylinder leaking from primary seal in cab, needs new brake master

**Replace Brake Master Cylinder + Bleed Brake System-
\$821.37 +tax**

Approved in person, 12:39pm 2/29/24

Written by Jimmy Purdy at 02/29/2024 06:40 PM

Clutch is worn, recommend clutch replacement, With possible rear main seal replacement

Clutch Replacement- \$1764.25 +tax

Approved in person, 12:39pm 2/29/24

Written by Jimmy Purdy at 02/29/2024 06:40 PM

Parking brake cable seized, cable to handle.

**Parking Brake Cable Replacement- Remove and replace
+ Adjustment \$440.75 +tax**

Approved in person, 12:39pm 2/29/24

Written by Jimmy Purdy at 02/29/2024 06:40 PM

Will need to remove steering wheel to access multifunction switch to assess blinkers, hazards are functional- will need 1.25hr to R&R + whatever needs to be addressed.

**Remove, Inspect and Repair Multi-Function Switch
\$281.25 +tax**

Approved in person, 12:39pm 2/29/24



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 18 of 23
06/10/2024 1:39 PM

Written by Jimmy Purdy at 02/29/2024 06:40 PM

Recommend rear differential pinion seal
Tcase front output seal
Front differential pinion seal
Engine oil pan gasket and front crank seal
Oil filter adapter gasket

Oil Filter Housing Adapter Gasket- Remove and Replace
- \$256.13 +tax

Approved in person, 12:39pm 2/29/24

Rear Differential Pinion Seal Replacement- \$238.18
+tax

Approved in person, 12:39pm 2/29/24

Front Crank Shaft Seal- Remove and Replace -
\$250.54 +tax

Approved in person, 12:39pm 2/29/24

Oil Pan Gasket Replacement- Engine- \$639.01 +tax

Approved in person, 12:39pm 2/29/24

Front Differential Pinion Seal Replacement- \$238.18
+tax

Approved in person, 12:39pm 2/29/24

Written by Jimmy Purdy at 02/29/2024 06:40 PM

Recommend steering gear box adjustment

Steering Gear Adjust + Fluid Fill (If Applicable)
\$225.00 +tax

Approved in person, 12:38pm 2/29/24

Written by Jimmy Purdy at 02/29/2024 06:40 PM

Found license plate wiring note connected, hard wired in, check for power and ground, good light is defective. It is an aftermarket LED set up

Remove and Install New OE Style License Plate Light
Fixture - \$301.48 +tax

Approved in person, 12:39pm 2/29/24

Written by Jimmy Purdy at 02/29/2024 06:40 PM

When clutch is being replaced recommend teardown and inspect transfer case for possible issues.



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 19 of 23
06/10/2024 1:39 PM

Teardown and Inspect Transfer Case- \$404.12 +tax

Approved in person, 12:39pm 2/29/24

Written by Kevin Larson at 02/29/2024 06:44 PM

2 Inch Lift- Replaces all worn out bushings, updates leaf springs, hardware, and new shocks.

Upgrade front and rear suspension with 2 inch lift- \$3814.95 +tax

Approved in person, 9:12am 3/8/24

Written by Kevin Larson at 03/07/2024 11:53 PM

Upgrade front and rear suspension with 2 inch lift- \$3814.95 +tax

Approved in person, 10:36am 3/12/24

Written by Kevin Larson at 03/08/2024 05:15 PM

Will need a timing cover gasket

timing cover gasket \$88.33 +tax

Approved in person, 10:36am 3/12/24

Written by Jimmy Purdy at 03/12/2024 05:35 PM

EFI Upgrade

Install/Tune EFI \$5073.53 +tax

Declined for Now by [REDACTED] 4:37pm 6/3/24

Written by Kevin Larson at 03/12/2024 10:55 PM

Trans out, bell housing off, clutch removed.



Written by Bradley Meredith at 03/14/2024 11:26 PM

The rear left brake shoes are on backwards need to take back apart and switch them.



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 20 of 23
06/10/2024 1:39 PM

Remove & Re-Install Rear Brake Shoes- \$225.00 +tax

Approved by phone, 10:34am 3/21/24

Written by Rob Krohn at 03/21/2024 05:33 PM

Installed the front hangers with new bushings. Also installed the track bar with new bushings. It will need an alignment, I had to adjust the track bar

Written by Anthony (AJ) Kemp at 04/05/2024 05:25 PM

Oil Pump/Filter -

\$98.41 +tax

Approved in person, 8:14am 4/9/24

Written by Kevin Larson at 04/09/2024 03:14 PM

Got the brake lights working, need a few dashboard lights #197, or #193, can't see the numbers also the bulb holder need 4 all together. 1 hour labor.

Replace Dash Light Bulbs + Holders & Replace Flasher Relay \$233.60 +tax

Approved in person, 3:31pm 4/12/24

Written by Rob Krohn at 04/12/2024 10:30 PM

Reverse lights work. They weren't plug in. Windshield wipers work but they make noise underneath the dash like it's binding up,, need time for further inspection/assessment

Advanced Assessment - Wiper System Binding / Making Noise- Time needed to inspect possible lubricate and or give direction on how to resolve- \$450.00 +tax

Declined for Now by [REDACTED] 4:37pm 6/3/24

Written by Rob Krohn at 04/15/2024 10:02 PM

New Tires- 265-75R15 Toyo Open Country A/T III

TIRE REPLACEMENT - \$800.00 +tax

Approved in person, 2:34pm 4/18/24

Written by Kevin Larson at 04/18/2024 03:32 PM



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 21 of 23
06/10/2024 1:39 PM

Final Notes: Heater core leaking - unavailable at this time for order

Heater core replacement \$663.00 +tax

Declined for Now by [redacted] 4:37pm 6/3/24

Written by [redacted] at 06/03/2024 04:37 PM

Final Notes: Heater core leaking - unavailable at this time for order

Written by Jimmy Purdy at 06/03/2024 04:38 PM

Adjusted the drag link took it apart cleaned out the old grease put it back together was able to tighten up the adjustment a little bit more. Steering gear and joint should be replaced.

Written by Rob Krohn at 06/10/2024 09:15 PM

heater core leaking, no replacement units available right now for direct fit. , gear box needs to be replaced

Written by Jimmy Purdy at 06/10/2024 09:16 PM

Steering Gear box - remove and replace

Steering Gear Replaced- \$1268.33 +tax

Approved by [redacted] 1:45pm 6/11/24

Written by Kevin Larson at 06/11/2024 08:20 PM

Heater Core Bypass

Heater Core - Bypass \$112.50 +tax

Approved by [redacted] 1:45pm 6/11/24

Written by Kevin Larson at 06/11/2024 08:23 PM

Buy passed heater core- Checked system, no leaks.



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 22 of 23
06/10/2024 1:39 PM

Written by Rob Krohn at 06/14/2024 08:28 PM



Shift N Gears Auto Repair

1621 North River Rd
Paso Robles CA 93446
805-238-6202
info@shiftngears805.com

Invoice #4761

Page 23 of 23
06/10/2024 1:39 PM

Attached Images:

